

Older Model List

(10 years and older)

730 Martin Luther King Jr Blvd Suite 300 Campus Box 3430 Chapel Hill, NC 27599-3430 | www.hsrc.unc.edu

HIGHWAY SAFETY RESEARCH CENTER CAR SEAT RECALL LIST ARCHIVE

Last Revision: April 5, 2021

Download this list & sign up for email notification of updates: buckleupnc.org/car-seat-recall-list

About Car Seats and Recalls

It is very important to pay attention to recall notices and for parents to check if their seats are safe to use. Recalls can be issued for any failure to meet Federal Motor Vehicle Safety Standard 213. Most recalls are issued due to reasons related to the crashworthiness of the car seat, but some recalls are for deviations from the standards related to labeling requirements, flammability of the upholstery or padding, or for parts that may come loose and pose a choking hazard. All recalls should be corrected.

Car seats are required to have a label indicating the manufacturer, model information, and date of manufacture. Car seats should not be used if these labels are missing. It is important for people to register their car seat by either mailing the registration card to the manufacturer or by contacting the manufacturer directly.

In cases where the manufacturer of a recalled seat has gone out of business or discontinued replacement programs, parents are advised to discontinue use of the seat. Discarded seats should be taken apart and stripped of upholstery, padding and straps and then destroyed by having them crushed to prevent others from using them.

To report any suspected car seat defects, call the National Highway Traffic Safety Administration Auto Safety Hotline at 888-327-4236 / (TTY): 800-424-9153.

About Older Car Seats and Recalls

The older model list includes recalled seats that are now 10 or more years old. Caregivers will sometimes choose to use older car seats even though it not recommended. Knowing that a particular model is under recall should help to encourage the caregiver to destroy the older seat and obtain a new one.

About the HSRC Recall List

The UNC Highway Safety Research Center (HSRC) car seat recall list is updated as soon as possible after recall notifications are announced and after the information can be verified for completeness and accuracy. Users of this (or any other) recall list should remind parents/caregivers to contact the manufacturer to be certain whether or not a particular car seat is affected by any recalls and how to proceed with repairs or replacement.

Instructions for Using the HSRC Recall List

Find the manufacturer, model name, model number, and date of manufacture on the label of the car seat. Using this information, look to see if the manufacturer, model, and dates of manufacture match any of the listings. The list is alphabetized by manufacturer and model name. When in doubt, contact the manufacturer for clarification.

For further information, contact:
Bevan Kirley or Kristel Robison
The University of North Carolina Highway Safety Research Center
800-672-4527 x2 or cps@hsrc.unc.edu
www.buckleupnc.org/car-seat-recall-list

This Page Intentionally Left Blank

Car seats manufactured before 1981 were not required to be crash tested and must not be used. Most manufacturers stamp their car seats with an expiration date, typically six to eight years from the date of manufacture, on a label or in the shell of the seat. Many child passenger safety advocates recommend that if no expiration date can be found, car seats older than ten years should be replaced by a new one. Older models are included as a part of this recall list because care givers will sometimes choose to use older car seats even though it goes against the recommendations of most organizations and advocates. Knowing that a particular model is under recall, and if the defect cannot be corrected, should help to encourage the care giver to destroy the older seat and obtain a new one.

Following are recalls and safety notifications that were issued for models where all or most models sold are at least 10 years old as of April 5, 2021. The listing of older models with recalls will only be updated as "newer" models get to be old enough to be moved to the "older" models list.

Programs that make multiple copies of the HSRC recall list, e. g., for use at clinics or permanent checking/fitting stations, should only have to make copies of this older model section when it is revised, regardless of how often the main (newer model) section is revised. Most clinics or permanent checking/fitting stations should only need to print/copy one or two older model lists for reference. Updated versions of this list, as well as the list of models less than 10 years old, are posted on-line at www.buckleupnc.org/car-seat-recall-list.

CAR SEATS 10 YEARS OLD AND OLDER

Download this list & sign up for email notification of updates: buckleupnc.org/car-seat-recall-list

Refer to Page 23 for the Index of Recalls and Safety Notifications

List No.	Manufacturer Model Name	Model # ("X" = more numbers or letters follow)	Customer assistance Mfg Date Problem Type and Consumer Action
	Alcot (Childca	nre)	ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE
201)	Child Love Seat		3/84-11/84 Plastic shell may develop cracks. Destroy & replace seat.
	All Our Kids		ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE
202)	Little Cargo Vest	600	4/93-3/94 Flammability of upholstery. Call mfg. for repair info.
203)	Little Cargo Vest	602 MODEL	3/94-9/94 Flammability of upholstery. Call mfg. for repair info.
	Alpha Elite (D	Porel)	Dorel Juvenile Group: 866-623-3139 / 800-219-0509 / 866-611-3022 / 812-372-0141 www.djgusa.com
204)	Alpha Luxe	22462x OLD	05/01/08- Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
205)	Alpha Omega All-N-1	22459x	05/01/08- Harness locking and release button does not always return to its locked position and 04/30/09 could result in a loose harness, increasing the risk of being injured a crash. Contact
	Alpha Omega Elite	22148x, 22149x, 22158x	mfg. for repair kit.

OLDER MODEL LIST

List	Manufacturer	Model # ("X" = more	Custome	r assistance
	Model Name	numbers or letters follow)		Problem Type and Consumer Action
	Alpha Elite (D	orel) (continued)		
206)	Comfort Infant Seat	22331 BLA, 22332 RLA	07/26/05- 02/28/06 DER	Trim screws on handle can loosen resulting in a potential choking hazard. Contact mfg. at 877-229-1374 for free repair kit. Make sure the handle trim screws are tight and continue to use the existing seat while waiting to receive and install the repair kit.
207)	Comfort Infant Seat	22331 BLA, 22332 RLA	07/26/05- 02/28/06	Some consumers have experienced difficulty installing the base in certain vehicles. Dorel will replace the original version of the base at no charge to the customer. Contact mfg. at 877-229-1374 to determine eligibility for a replacement base.
	Alpha Sport (L	Dorel)	Dorel Juv www.djgu	renile Group: 866-623-3139 / 800-219-0509 / 866-611-3022 / 812-372-0141 usa.com
208)	Enspira	22452x, 22458x	05/01/08- 04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
209)	Vantage R	22546x, 22547x	05/01/08- 04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
	American Mot	ors		ELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM INUED - DESTROY & REPLACE
210)	Infant Love Seat	AII OLD	1/81-12/82	Plastic shell may develop cracks. Destroy & replace seat.
211)	Child Love Seat	All	3/84-11/84	Plastic shell may develop cracks. Destroy & replace seat.
	Baby Trend		800-328-7	363 - www.babytrend.com
212)	Rigid Latch-Loc	6439, 6448, 6481	05/14/07- 04/01/08	Incorrect steel used on the latch connector can crack and allow the child seat base to detach from the vehicle's latch anchors during a severe crash. Contact mfg. for a replacement base. Install with vehicle seat belt until base is replaced.
213)	Rigid Latch-Loc Base	6400	05/14/07- 04/01/08	Incorrect steel used on the latch connector can crack and allow the child seat base to detach from the vehicle's latch anchors during a severe crash. Contact mfg. for a replacement base. Install with vehicle seat belt until base is replaced.
O	Babyhood Ind	ustries ODEL		ELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM INUED - DESTROY & REPLACE
214)	Wonda Chair	810	Pre 12/82	Harness may be misrouted. Call mfg. for instructions.
215)	Baby-Sitter	8200	1/92-6/93	Buckle. Call mfg. for repair info.
	Basic Comfor	OLD	<i>_</i>	DELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM INUED - DESTROY & REPLACE
216)	Galaxy 2000	960, 961	ALL	Crash test failure. Call mfg. for repair info.
217)	Galaxy 2000	960, 961	11/98-1/99	Faulty molding of foam backs and cushions may allow separation of part of the booster seat. Call mfg. for repair info. OLDER MODEL LIST

For the model numbers "x" = more numbers or letters follow

List Manufacturer Model # ("X" = more Customer assistance Model Name numbers or letters follow) Mfg Date Problem Type and Consumer Action Beatrix Potter (Dorel) Dorel Juvenile Group: 800-219-0509 / 866-611-3022 / 812-372-0141 www.digusa.com 218) Designer 22 02-621-SAL, 02-620-xxx 01/03/02-Plastic handle can unexpectedly release from the carrying position when used as a 02/13/02 carrier. Does not affect safety as a child restraint. Contact mfg. for repair kit. Bertini (Dorel) Dorel Juvenile Group: 866-623-3139 / 800-219-0509 / 866-611-3022 / 812-372-0141 www.djgusa.com 05/01/08-Harness locking and release button does not always return to its locked position and 219) SureFit (Travel 22346x 04/30/09 could result in a loose harness, increasing the risk of being injured a crash. Contact system) mfg. for repair kit. ALL MODELS OLDER THAN 10 YEARS - NO LONGER IN BUSINESS -**Bolform Corp. DESTROY & REPLACE** Crash test failure. Destroy & replace. 220) Buckle-Up-Harness 888-427-4829 / 704-409-1700 **Britax** www.britaxusa.com 221) Advantage E902228 03/05/01-One of the tether brackets of affected seats may separate from the tether attachment point. Contact mfg. for repair kit. 07/26/01 03/01/06-Top tether hook can open during a crash allowing the restraint to change from an 222) Boulevard E9L57 08/01/06 upright to a reclined position. Owners are being advised to discontinue use of the top tether when the child reaches 50 lbs. Contact mfg. for replacement labels. E9L69N9, E9L69P2, 04/01/09-The chest clip may break when it is engaged as the infant is secured into the infant 223) Chaperone car seat creating a safety hazard. Contact mfg. for repair kit. E9L69P3, E9L69P5 05/31/10

09/01/10-

04/30/11 10/31/03-

06/06/04

02/12/05-

07/31/07

E9L47

101

E9L14

E9L692J, E9L692K,

E9L692L, E9L692M

224) Chaperone

225) Companion

227) Decathlon

228) Freeway

229) Frontier

Pre- User Guide Update - NOT A RECALL: Britax has updated instructions regarding adjustment of the buckle strap position and maximum height for infant carrier use

improperly installed rivet. Contact mfg. for repair kit.

adjustment of the buckle strap position and maximum height for infant carrier use. The inner buckle strap position should be used for infants weighing less than 11 pounds. A child has exceeded the height limit for the Companion when the top of the head is less than one inch from the top of the child restraint or the child's height exceeds 30 inches (76 cm). Contact mfg for updated user guide and labels

One or both of two tabs on the bottom of the carrier may not be properly seated and

Voluntary Recall - The harness adjuster may detach from the shell due to an

may allow the carrier to rotate in the base too far in a crash. Correct/incorrect assembly can be determined by visual examination. Call mfg. for replacement info. Affected units may be installed without the base until receiving a replacement.

Under certain circumstances the harness adjuster housing may separate from the child restraint shell and allow the adjuster to move out of position. If this happens caregivers may experience difficulty adjusting the harness. Call mfg. for repair info.

6/96-4/97 Buckle. Call mfg. for repair info.

E9L54E7, E9L54H6, 04/01/08- Harness straps may become detached from the metal yoke on the back of the seat E9L54H7, E9L54M6 09/14/08 If they are loosened one strap at a time with excessive force. Contact mfg. for repair

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

List No.	Manufacturer	Model # ("X" = more		assistance
140.	Model Name	numbers or letters follow)	Mfg Date	Problem Type and Consumer Action
	Britax (contin	ued)		
230)	Frontier	E9L5490	04/01/08- 09/17/08	Harness straps may become detached from the metal yoke on the back of the seat If they are loosened one strap at a time with excessive force. Contact mfg. for repair
231)	Husky	E9L30	08/01/02- 12/31/03	kit. Head excursions higher than allowed by FMVSS 213 could result when installed as instructed with a long/serpentine belt path. Contact mfg. for replacement labels advising the use of an alternative short belt path.
232)	Husky	E9L30	Pre- 07/24/04	The adjuster strap may slip within the metal buckle that controls the tightness of the shoulder harness and may allow the harness to loosen. Contact mfg. for repair kit.
233)	Marathon	E9L06	Pre- 07/24/04	The adjuster strap may slip within the metal buckle that controls the tightness of the shoulder harness and may allow the harness to loosen. Contact mfg. for repair kit.
234)	Marathon	E9L06, E9W06, E906 with top tether lot # KGR 01 A	05/23/06- 07/28/06	The top tether hook may open and have the potential to release from the tether anchor if the child exceeds 50 pounds. Contact mfg. for repair kit.
235)	Regent LDER	E9L39x MODEL	11/10/05- 06/18/07	Consumer Advisory/Product Update - NOT A RECALL: Britax has modified the Regent and revised the installation instructions. Contact mfg. to receive a free product update kit that includes a revised user guide, replacement belt-routing label, a longer LATCH connector strap, and adhesive slip resistant strips.
236)	Regent Classic	E9L3998	12/18/06- 01/18/07	Affected seats were produced with an incorrect airbag warning label attached to the cover. Contact mfg. to receive a free replacement cover.
237)	Roundabout	OLD	1/99-3/99	Possible faulty molding of shell can allow excessive head excursion. Call mfg. for repair info.
238)	Super Elite	E9031	04/25/01- 02/15/02	Harness may allow too much forward head movement. Contact mfg. to receive a free replacement harness system.
239)	Super Elite	E9031	04/01/01- 08/31/02	Harness adjuster tab may begin to stick after prolonged use. Harness may loosen if it sticks in the open position. Contact mfg. for repair kit and installation instructions.
240)	Traveller Plus	E9L32 (Mfg. by Britax for Snug Seat)	Pre- 07/24/04	The adjuster strap may slip within the metal buckle that controls the tightness of the shoulder harness and may allow the harness to loosen. Contact mfg. for repair kit.
241)	Wizard	E9L07	Pre- 07/24/04	The adjuster strap may slip within the metal buckle that controls the tightness of the shoulder harness and may allow the harness to loosen. Contact mfg. for repair kit.
0	Century Produ	ucts VODEL	800-837-4	044 / 216-468-2000
242)	100	4100	1/81-4/81	Upholstery buttons. Call mfg. for repair info.
243)	100	4100	4/85-2/86	Plastic shell may crack in crash. Call mfg. for repair info.
244)	1000 STE	4153, 4163, 4180	12/90- 10/91	Incorrect labels on seat. Call mfg. for corrections
245)	200	4200, 4210, 4235, 4214, 4223	1/81-4/81	Upholstery buttons. Call mfg. for repair info.
246)	200	4200, 4210, 4235, 4214, 4223	June 81	Washers on frame. Call mfg. for repair info.
247)	200	4200, 4210, 4235, 4214, 4223	1/81-1/83	Buckle. Call mfg. for repair info.
248)	200	4200, 4210, 4235, 4214, 4223	4/85-2/86	Plastic shell may crack in crash. Call mfg. for repair info.

List No.	Manufacturer	Model # ("X" = more		assistance
	Model Name	numbers or letters follow)	Mtg Date	Problem Type and Consumer Action
	Century Produ	ucts (continued)		
249)	2000 STE	4253, 4263, 4265	4/84-6/89	Harness. Call mfg. for repair info.
250)	2000 STE	4253, 4261, 4263, 4265, 4266	12/90- 10/91	Incorrect labels on seat. Call mfg. for corrections
251)	2000 STE	4253, 4261, 4263, 4265, 4266	12/91-4/92	Buckle. Call mfg. for repair info.
252)	300	4300, 4302, 4303, 4323, 4310, 4334, 4335	4/85-2/86	Plastic shell may crack in crash. Call mfg. for repair info.
253)	3000 STE	4365DT, 4366	3/89-10/89	Upholstery. Call mfg. for repair info. Crash test failure of buckle. Call mfg. for repair info.
254)	3000 STE	4353, 4365, 4366, 4368	5/90-6/90	Crash test failure of buckle. Call mfg. for repair info.
255)	3000 STE	4353, 4365, 4366, 4368	Pre 91	Buckle instructions. Call mfg. for corrections
256)	3000 STE	4365, 4366, 4367, 4368, 4369, 4380, 4381	12/90- 10/91	Incorrect labels on seat. Call mfg. for corrections
257)	3000 STE	4353, 4365, 4366, 4367, 4368, 4369	10/89-4/92	Buckle. Call mfg. for repair info.
258)	3500 STE	4380	12/90-4/92	Buckle. Call mfg. for repair info.
259)	4-In-1 Travel System	11-570, 11-597, 11-600, 11-650	9/95-5/96	Buckle. Call mfg. for repair info.
260)	4-In-1 Travel System	11-564, 11-565, 11-570, 11-575, 11-576, 11-578, 11-595, 11-597, 11-598, 11-599, 11-600	01/01/91- 07/31/97	Handle can break when the seat is used as an infant carrier causing the infant to fall to the ground be injured. Does not affect safety as car seat. Call 800-865-1419 for replacement handle.
261)	400XL	4400, 4434, 4436, 4446	4/85-2/86	Plastic shell may crack in crash. Call mfg. for repair info.
262)	400XL	4400, 4434, 4436, 4446	11/84-4/86	Shield. Call mfg. for repair info.
263)	5000 STE	4450, 4460, 4475	12/88- 11/89	Buckle. Call mfg. for repair info. R MODEL LIST
264)	5000 STE	4450, 4460, 4470, 4475	5/90-6/90	Crash test failure of buckle. Call mfg. for repair info.
265)	5000 STE	4460, 4470, 4475, 4476, 4480, 4490	12/90- 10/91	Incorrect labels on seat. Call mfg. for corrections
\mathbf{O}'	5000 STE	4450, 4460, 4470, 4475, 4476	LIS	Buckle. Call mfg. for repair info.
,	5000 STE	4450, 4460, 4470, 4475,	Pre 91	Buckle instructions. Call mfg. for corrections.
,	5500 STE	4480, 4490		Buckle. Call mfg. for repair info.
,	580	4581, 4583, 4585		Screws for carry handle. Call mfg. for repair info.
,	580	4580, 4581, 4583, 4585		Incorrect instructions. Call mfg. for corrections.
271)	Accel	45100, 45200, 45600, 45700	04/09/01- 05/10/01	Harness adjustment lock may allow webbing to slip during a serious crash when used in the forward facing mode for some models and lot codes. Call Century at 1-800-575-6097 for replacement info.
272)	Affinity Infant Seat	4575	9/95-5/96	Buckle. Call mfg. for repair info.
273)	Bravo	44622, 44630, 44631, 44662	04/09/01- 05/10/01	Harness adjustment lock may allow webbing to slip during a serious crash when used in the forward facing mode for some models and lot codes. Call Century at 1-800-575-6097 for replacement info.

For the model numbers "x" = more numbers or letters follow

List Manufacturer Model # ("X" = more Customer assistance No. Model Name numbers or letters follow) Mfg Date Problem Type and Consumer Action **Century Products (continued)** 274) Breverra 4875 2/95-7/98 Product improvement campaign: Buckle for the harness can crack or break. Call Contour mfg. for replacement information. 2/95-7/98 Product improvement campaign: Buckle for the harness can crack or break. Call 275) Breverra 4885 mfg. for replacement information. Premiere 276) Child Love Seat 4600 3/84-11/84 Plastic shell may develop cracks. Destroy & replace seat. 277) Encore 44612, 4662 Harness adjustment lock may allow webbing to slip during a serious crash when 05/10/01 used in the forward facing mode for some models and lot codes. Call Century at 1-800-575-6097 for replacement info. 9/95-5/96 Buckle. Call mfg. for repair info. 278) Infant Car Seat 4535, 4560, 4565, 4590 279) Infant Car Seat 12-565, 4513, 4515, 4516, 01/01/91-Handle can break when the seat is used as an infant carrier causing the infant to fall 4518, 4551, 4557, 4558, 07/31/97 to the ground be injured. Does not affect safety as car seat. Call 800-865-1419 for 4559, 4564, 4565, 4566, replacement handle. 4568, 4569, 4575, 4576, 4589, 4591, 4593, 4594, 4595, 4597 280) Infant Love 4500, 4510, 4520 1/81-12/82 Plastic shell may develop cracks. Destroy & replace seat. seat 281) Smart Fit 4525 Buckle. Call mfg. for repair info. 9/95-5/96 282) Smart Move 4750 11/95-2/96 Buckle. Call mfg. for repair info. 04/09/01-Harness adjustment lock may allow webbing to slip during a serious crash when 283) Smart Move 44709 05/10/01 used in the forward facing mode for some models and lot codes. Call Century at 1-800-575-6097 for replacement info. Chicco 800-807-8817 / 877-424-4226 - www.chiccousa.com Recall applies only to bases manufactured between 2/26/2008 and 3/17/2008. 284) Key Fit ΑII 02/26/08-When installed with LATCH, the webbing used to tighten the base can slip through 03/17/08 Key Fit 30 the adjustment lock. Bases with serial number is between 08 02 26 (February 26, Cortina Travel 2008) and 08 03 17 (March 17, 2008) are covered by this recall. Contact mfg. for Systems **BASES ONLY** replacement base. Install the base with the vehicle seat belts until replacement base is obtained. Chrysler ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM **DISCONTINUED - DESTROY & REPLACE** 285) Child Love Seat All 3/84-11/84 Plastic shell may develop cracks. Destroy & replace seat. 800-544-1108 Collier-Keyworth Shield. Call mfg. for repair info 286) Co-Pilot ΑII 12/84-4/85 Buckle. Call mfg. for repair info. 287) Safe & Sound II All 288) Commuter ΑII 10/87-Padding. Call mfg. for repair info. 02/88 OLDER MODEL LIST

For the model numbers "x" = more numbers or letters follow

List Manufacturer Model # ("X" = more Customer assistance Model Name numbers or letters follow) Mfg Date Problem Type and Consumer Action Combi USA 800-992-6624 / 803-548-6633 - www.combi-intl.com 8100 289) Avatar Lower latch anchorage does not meet dynamic test requirements of FMVSS 213. Contact mfg. for free in-home repair kit and instructions. Affected models should be 05/07/04 installed with the vehicle seat belt. Do not use the seat with the latch until repairs are made. 8065 290) Centre ST 10/19/05-The car seat could potentially become separated from its base in a crash. Mfg. Centre DX 8074 12/15/07 recommends that the car seat be used without the base until it has been fixed. Centre EX 8086 Contact mfg for free retrofit kit. Also affected are travel systems (# 4400, 4515, and Centre ARB 4520) that contain the Centre and Shuttle car seats. 8520 8087 10/19/05-The car seat could potentially become separated from its base in a crash. Mfg. 291) Shuttle 12/15/07 recommends that the car seat be used without the base until it has been fixed. Contact mfg for free retrofit kit. Also affected are travel systems (# 4400, 4515, and 4520) that contain the Centre and Shuttle car seats. 07/15/07 -Harness webbing fails to meet FMVSS 213 minimum breaking strength 292) Zeus Turn 03/25/09 requirements. Contact mfg. for free harness replacement kit and instructions. The seats can continue to be used until the kits are made available and repairs are made. Compass Baby 888-899-2229 - www.compassbaby.com 293) Infant Car Seat 1420 ARD The metal slide crotch anchor can become dislodged allowing excessive movement 05/07/06, 1420 FUO 05/13/06 of the child and cracking of the plastic shell. This problem was discovered during 1420 MAR and testing by the manufacturer. There have been no reports of injuries and no calls 05/15/06 from consumers regarding problems. Contact mfg. for free repair kit. Dorel Juvenile Group: 800-219-0509 / 866-611-3022 / 812-372-0141 Cosco (Dorel) Tether webbing could be cut and separate in a crash allowing excessive movement 294) Alpha Omega 02-331, 02-332, 02-531, 11/17/00-01/10/01 of the child. Contact mfg. for free repair kit. 02-533, 02-537, 02-555. 02332, 02531, 02533, 01/01/00-Tether webbing does not conform to abrasion requirements of FMVSS 213. Contact 295) Alpha Omega 02537, 02555 09/30/01 mfg. for free repair kit. 22150, 22180, 22269 11/01/03-296) Alpha Omega There is a potential for the harness adjustment strap to loosen during use. Contact 12/31/05 Alpha Omega 22155 mfg. for free repair kit. Elite 05/01/08-297) Alpha Omega 22154x, 22155x, 22158x Harness locking and release button does not always return to its locked position and 04/30/09 could result in a loose harness, increasing the risk of being injured a crash. Contact Elite mfg. for repair kit. 298) Alpha Omega 22150x 05/01/08-Harness locking and release button does not always return to its locked position and 04/30/09 All-N-1 could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit. 03/95-299) Arriva 02-751 Buckle. Call mfg. for repair info. 05/95 300) Arriva 02-729 TED 03/31/99-Airbag warning label is missing on seat pad. Fabric color noted by "TED" is only one 04/07/99 affected. Call mfg. for replacement pad. R Model List

List Manufacturer	Model # ("X" = more	Custome	c assistance
No. Model Name	MODE! # ("X" = more numbers or letters follow)		Problem Type and Consumer Action
Cosco (Dorel)) (continued)		
301) Arriva	02-665, 02-727, 02-728, 02-729, 02-731, 02-732, 02-733, 02-750, 02-751, 02-755, 02-756, 02-757, 02-774	03/01/95- 01/31/00)ER	Handle locks can unexpectedly release when used as a carrier, causing the seat to flip forward. Does not affect safety as car seat. Call mfg. for repair info. [Note: a recall campaign initiated 06/25/03 added models made through 01/31/00 to a previous recall of those made through 09/97.]
302) Infant Car Seat	22-300 CSF, 22-300 FZN, 22-300 JJV, 22-300 OSF, 22-300 THD, 22-300 TWD	01/06/08-0 4/06/09	The child restraint carry handle can loosen and come off posing a fall hazard to infants. The safety as a child restraint is not affected. Do not use handle until repaired. Contact mfg. for free repair kit. NOTE: Only those models sold as a part of the Spirit and Sprint Travel Systems are affected.
303) Commuter	02-086	11/87-2/88	Upholstery/padding. Call mfg. for repair info.
304) Designer 22	22-300-JOS GB1B	08/19/03- 10/20/04	Harness can loosen if not properly tightened. Contact mfg. for free repair kit. Parents should continue to use the seat while waiting to receive/install the repair kit but are advised to make sure that the seat is properly adjusted while in use. NOTE: Models involved were sold only as travel systems (with a stroller) and any line code other than GB1B in the model # is not included in the recall.
305) Dream Ride	02-719 ARQ	01/89- 01/94	Upholstery flammability. Call mfg. for repair info.
306) DreamRide	22-001FSM	12/01/03- 04/28/04	Failed to meet back support angle requirements of FMVSS 213. Discontinue rear-facing use and use only as a car bed or request free replacement rear-facing child restraint from DJG. Contact mfg. for warning label and information.
307) Hi Back Booster	02409, 02442, 02443, 02445, 02448, 02449, 02450, 02480, 02495	01/01/00- 09/30/01	Tether webbing does not conform to abrasion requirements of FMVSS 213. Contact mfg. for free repair kit.
308) Hi Back Booster	02442, 02443, 02448, 93443, 93514	03/15/02- 08/01/02	UV stabilizer in harness webbing does not conform to requirements of FMVSS 213. Contact mfg. for free repair kit.
309) High Rise Booster	22-297, 22-298, 22-299	10/01/03- 10/31/03	Incorrect warning label stating it is for use forward facing for children under one year of age rather than OVER one year of age. Contact mfg. for free replacement label and instructions.
310) Luxury Soft Shield Auto Trac	02-790, 02-890	10/89-6/90	Crash test failure. Call mfg. for repair info.
311) Regal Ride	22139MON DEL		Elastic straps on padding can come loose and become accessible to the child allowing the child to loop the elastic strap around portions of his/her body. Contact mfg. for repair kit.
312) Safe-T-Shield	81A or B, 181A or B	10/80-6/83	Shield. Call mfg. to replace seat.
313) Safe-T-Mate		1984	Wrong instructions. Call mfg. for repair info.
314) Safe and Easy 315) Safe and Snug	313 323, 423	1/84-6/85 1/84-6/85	Plastic shell. Call mfg. for repair info. Plastic shell. Call mfg. for repair info.
316) Sidekick Booster	244x	04/96-5/97	Crash test failure of shield. Use only as belt-positioning booster. Call mfg. for refund info.
317) Soft Shield	02-090	10/89-6/90	Crash test failure. Call mfg. for repair info.
318) Soft Shield Auto Trac	02-290	10/89-6/90	Crash test failure. Call mfg. for repair info.

For the model numbers "x" = more numbers or letters follow

List Manufacturer Model # ("X" = more Customer assistance Model Name numbers or letters follow) Mfg Date Problem Type and Consumer Action Cosco (Dorel) (continued) 319) Soft Shield 02-190 10/89-6/90 Crash test failure. Call mfg. for repair info. Deluxe Buckle. Call mfg. for repair info. 02-084 5/94-8/94 320) Touriva 8/97 321) Touriva Shield 02-014-EMF Crash test failure of shell in front-facing recline position. Call mfg. for repair info. 02-014-GDM, (Mold #3) 02-015-PDL 322) Touriva 5-point 02-514-BWE, 8/97 Crash test failure of shell in front-facing recline position. Call mfg. for repair info. 02-584-OXF, (Mold #3) 02-518-NDF 323) Touriva T-02-084, 02-094, 5/96-11/97 Crash test failure of post-test release pressure standard for the buckle. Call mfg. for 02-096, 02-404, Shield repair info. 02-821 324) Touriva 02014, 02015, 02019, 01/01/00-Tether webbing does not conform to abrasion requirements of FMVSS 213. Contact 02084, 02094, 02114, mfg. for free repair kit. 09/30/01 02504, 02514, 02518, 02519, 02524, 02584, 02803, 02806, 02821, 02825, 02935, 93084, 93094, 93514 325) Touriva 02514, 02519, 02524 03/15/02-UV stabilizer in harness webbing does not conform to requirements of FMVSS 213. 08/01/02 22100, 93446, 93504 Contact mfg. for free repair kit. 09/28/04-0 Elastic straps on padding can come loose and become accessible to the child 326) Touriva 22100x, 22111x, 22130x, 9/20/07 allowing the child to loop the elastic strap around portions of his/her body. Contact 93100x, 93111x mfg. for repair kit. 327) Trooper 219x, 224x, 10/96-2/97 Crash test failure. Call mfg. for repair info. 225x, 229x 328) Turnabout 02-667, 02-753, 02-756, 03/01/95-Handle locks can unexpectedly release when used as a carrier, causing the seat to 02-758, 02-759, 02-760, 01/31/00 flip forward. Does not affect safety as car seat. Call mfg. for repair info. [Note: a 02-761, 02-762, 02-763, recall campaign initiated 06/25/03 added models made through 01/31/00 to a 02-764, 02-765, 02-770, previous recall of those made through 09/97.] 02-771, 02-772 329) Voyager Infant All 9/97-10/97 Potential dislodgement from stroller. Does not affect safety as car seat. Call mfg. for Seat/Stroller repair info. Cybex Distributed by Regal Lager: 800-593-5522 - www.regallager.com 330) Solution X-fix 0500200xx, 0500760xx Booster seats have an incorrect warning statement about restraining unoccupied 02/28/10 seats. Contact mfg. for replacement sticker and owner's manual. Disney (Dorel) Dorel Juvenile Group: 866-623-3139 / 800-219-0509 / 866-611-3022 / 812-372-0141 www.djgusa.com 01/06/08-0 The child restraint carry handle can loosen and come off posing a fall hazard to 331) Infant Car Seat 22-305 NAB, 22-305 PPH, 22-355 LBF, 22-355 PWK, 4/06/09 infants. The safety as a child restraint is not affected. Do not use handle until 22-627 AWF repaired. Contact mfg. for free repair kit. NOTE: Only those models sold as a part of the Propack Travel System are affected.

Page 10 of 31

For the model numbers "x" = more numbers or letters follow

No. Model Name	Model # ("X" = more numbers or letters follow)	Customer assistance Mfg Date Problem Type and Consumer Action		
Downunder		ALL MODELS OLDER THAN 10 YEARS - NO LONGER IN BUSINESS - DESTROY & REPLACE		
332) Kangaroo Booster Seat	All (Pre- 1/98)	Safety improvement campaign: The shoulder belts may not be properly located when the child is placed in the restraint. The shoulder belt guides may not help achieve correct seat belt placement. Do not use this booster if the shoulder belt does not touch the child's chest.		
Eddie Bauer	(Dorel)	Dorel Juvenile Group: 800-219-0509 / 866-611-3022 / 812-372-0141		

	Eddie Bauer (Dorei)	www.djgu	eniie Group: 800-219-0509 / 800-611-3022 / 812-372-0141 isa.com
333)	3-in-1	02-331, 02-332, 02-531, 02-533, 02-537, 02-555	11/17/00- 01/10/01	Tether webbing could be cut and separate in a crash allowing excessive movement of the child. Contact mfg. for free repair kit.
334)	3-in-1 Deluxe 3-in-1 Deluxe Convrt.	22740, 22750, 22755, 22756, 22757, 22770	11/01/03- 12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
335)	Alpha Omega Alpha Omega Elite	22750, 22755, 22756, 22757, 22770	11/01/03- 12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
336)	Comfort Infant Seat	22630xxx, 22631xxx	07/26/05- 02/28/06	Trim screws on handle can loosen resulting in a potential choking hazard. Contact mfg. at 877-229-1374 for free repair kit. Make sure the handle trim screws are tight and continue to use the existing seat while waiting to receive and install the repair kit. (The 22630 models are part of the 01726 Eddie Bauer Integrated Travel System.)
337)	Comfort Infant Seat	22630xxx, 22631xxx	07/26/05- 02/28/06	Some consumers have experienced difficulty installing the base in certain vehicles. Dorel will replace the original version of the base at no charge to the customer. Contact mfg. at 877-229-1374 to determine eligibility for a replacement base.
338)	Deluxe 3-in-1	22755x, 22758x, 22759x, 22790x, 22799x	05/01/08- 04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
339)	Deluxe 3-in-1	22790xxx, CC046xxx	07/20/10- 05/18/11	The rear-facing belt path installation arrows are incorrect, possibly appearing to point toward the forward-facing vehicle belt path location. Contact mfg. for replacement label kit.
340)	Designer 22	22-625 xxx GB1B	08/19/03- 10/20/04	Harness can loosen if not properly tightened. Contact mfg. for free repair kit. Parents should continue to use the seat while waiting to receive/install the repair kit but are advised to make sure that the seat is properly adjusted while in use. NOTE: Models involved were sold only as travel systems (with a stroller) and any line code other than GB1B in the model # is not included in the recall.
341)	Enspira	22740	11/01/03- 12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
342)	Enspira	22740x, 22741x	05/01/08- 04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
343)	Hi Back Booster	02409, 02442, 02443, 02445, 02448, 02449, 02450, 02480, 02495	01/01/00- 09/30/01	Tether webbing does not conform to abrasion requirements of FMVSS 213. Contact mfg. for free repair kit.
		02 100, 02 100, 02 100		

OLDER MODEL LIST

Page 11 of 31

List	Manufacturer	Model # ("X" = more		assistance
	Model Name	numbers or letters follow)	Mfg Date	Problem Type and Consumer Action
	Eddie Bauer (Dorel) (continued)		
344)	Infant Car Seat	22-627 CGT, 22-627 FRK, 22-627 KGS, 22-627 SNW, 22-627 WPR, 22-655 BYTE	01/06/08- 04/06/09 ER	The child restraint carry handle can loosen and come off posing a fall hazard to infants. The safety as a child restraint is not affected. Do not use handle until repaired. Contact mfg. for free repair kit. NOTE: Only those models sold as a part of the Adventurer and Endeavor Travel Systems are affected.
,	Prospect Adjustable Hiback Booster	22880x	05/01/08- 04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
346)	SureFit	22657x, IC072x	05/01/08- 04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
347)	Touriva	02870, 02871, 02875	01/01/00- 09/30/01	Tether webbing does not conform to abrasion requirements of FMVSS 213. Contact mfg. for free repair kit.
348)	Evenflo R	MODEL	1 1.7	472 / 800-233-5921 Harness/shield. Call mfg. for repair info.
349)	Bobby Mac Champion	411	4/85-4/90	Buckle. Call mfg. for repair info.
350)	Bobby Mac Deluxe	412, 414, 415, 416	4/85-4/90	Buckle. Call mfg. for repair info.
351)	Booster Seat	470, 471	2/87-8/88	Upholstery buttons. Call mfg. for repair info.
352)	Booster Seat	242, 470, 471	4/85-4/90	Buckle. Call mfg. for repair info.
353)	Champion	224x	06/93- 11/96	Crash test failure. Call mfg. for repair info.
354)	Champion	224x	06/93- 11/96	Crash test failure. Call mfg. for repair info.
355)	Champion	219x, 224x, 225x, 229x	10/96-2/97	Crash test failure. Call mfg. for repair info.
356)	Cozy Carry	272x, 273x, 468x, 469x, 476x, 477x, 478x, 480x,	ALL (11/01/01-	Upgrade Kit - Not a Recall: For owners of Cozy Carry infant car seats to improve the performance of the detachable base in certain types of collisions. The kit is only for
0	LDER	481MODEL	08/31/02)	detachable bases with the words "Cozy Carry" on them. Visit www.cozycarry.com or call 800-582-6698 for free kit.
357)	Discovery	390, 391, 534, 552	Pre- 02/01/08	Voluntary Safety Recall - Testing showed that the car seat could potentially become separated from its base in high impact side collisions. Contact mfg. for free supplemental dual-hook fastener for enhanced safety performance.
358)	Discovery	3021769Z, 3021854Z	02/04/08)ER	A small number of Discovery car seats may have shipped without complete assembly of the red release handle located on the back of the seat making it possible for the seat to separate from its base. Contact mfg. for replacement seat and base. Affected models can be used without the base while waiting for replacement.
359)	Dyn-O-Mite	441 thru 448	1/85-1/89	Crash test failure. Call mfg. for repair info.
360)	Dyn-O-Mite	202, 441 thru 448	4/85-4/90	Buckle. Call mfg. for repair info. OLDER MODEL LIST

374) Seven Year

375) Seven Year

(Joyride + base)

(Joyride +

376) Travel Tandem 205x

377) Travel Tandem 205x, 210x

Seat

Seat

453, 454

Page 12 of 31

For the model numbers "x" = more numbers or letters follow

	Manufacturer Model Name	Model # ("X" = more numbers or letters follow)		Problem Type and Consumer Action
	Evenflo (cont	inued)		
361)	Embrace	Begins with 317, 320, 397, 398, 540, 548, 549, 550, 556, 597, 598, 599	Pre- 04/08/06 ER	When used as an infant carrier, the handle can unexpectedly release, causing the seat to rotate forward. Handle should not be used until the repair kit has been installed. Affected restraints can continue to be used as a car seat properly installed in a vehicle. Contact mfg. for a free repair kit.
362)	First Choice	3604098	01/16/09- 09/29/09	A label containing certain contact and certification information was inadvertently left off these car seats. Contact mfg. for a set of replacement labels.
363)	Infant Car Seat	456, 458	Pre 04/89	Crash test failure. Call mfg. for repair info.
364)	Infant Car Seat	201, 202, 441 thru 446, 448, 456, 458	04/85- 04/90	Buckle. Call mfg. for repair info. LDER MODEL LIST
365)	Joyride	Begins with 203, 205, 210, 435, 493	01/88- 12/98	When used as an infant carrier, the carry handle can unexpectedly release, cause he seat to flip forward, and cause infant to fall to the ground. Call mfg. for repair info.
366)	Maestro DER	3101198, 3101980, 31011048, 31011049, 31011059, 31011057C*	11/24/09- 04/09/10*	A crack may form at the front of the seat adjacent to the harness adjuster in a crash. Evenflo recommends that the seat not be used with children < 40 pounds until repaired. Use as a booster for children > 40 pounds is OK. Call mfg. for free reinforcement kit. *Canadian seat 31011057C mfg dates: 12/17/09-04/26/10
367)	On My Way	Begins with 207, 492	12/95- 07/97	When used as a carrier, the locking mechanism on the handle can slip, flipping the seat forward and tossing the baby on the ground. Call mfg. for repair info.
368)	On My Way	Begins with 200, 211, 447, 499	Pre- 02/10/00	Safety Notification: Alignment posts in base can become bent after repeated use. Contact mfg. for free upgrade kit.
369)	On My Way base	639001, 639002	Pre- 02/10/00	Safety Notification: Alignment posts in base can become bent after repeated use. Contact mfg. for free upgrade kit.
370)	One-Step	221, 401 thru 409	04/85- 04/90	Buckle. Call mfg. for repair info.
371)	One-Step Deluxe	222, 223, 4176	04/85- 04/90	Buckle. Call mfg. for repair info.
372)	Scout	229x	06/93- 12/96	Crash test failure. Call mfg. for repair info.
373)	Scout	219x, 224x, 225x, 229x	10/96- 02/97	Crash test failure. Call mfg. for repair info.

base)
378x, 379x
09/08/05- Certain areas of the plastic shell may be prone to stress fractures. Call mfg. to

Upholstery buttons. Call mfg. for repair info.

Test failure with base. Use without base and call mfg. for repair info.

When used as an infant carrier, the carry handle can unexpectedly release, cause

he seat to flip forward, and cause infant to fall to the ground. Call mfg. for repair info.

Buckle. Call mfg. for repair info.

09/08/05 Certain areas of the plastic shell may be prone to stress fractures. Call mig. to 09/22/05 receive a replacement seat.

02/87-

08/88

04/85-

04/90

01/88-

03/96

01/88-12/98

379) Triumph 264x 10/20/01- Slide loop connectors in the harness may not be strong enough to fully secure the child in a crash. Call mfg. for repair kit.

List No.	Manufacturer Model Name	Model # ("X" = more numbers or letters follow)		Problem Type and Consumer Action
	Evenflo (conti	nued)		
380)	Triumph	264x, 359x, 389x	09/06/01- 10/31/05	Portions of the cloth cover can be pulled back exposing the foam liner in an area that is reachable by a child occupant. A child inside the seat may break off and potentially choke on a piece of the foam liner. Contact mfg. for repair kit.
381)	Trooper (shield)	21940, 219164, 219180, 219186, 219188	11/95-1/96	Instructions. Call mfg. for new instructions
382)	Two-in-One	636x, 637x	1/98-3/98	In crash tests, the seat's backrest and base have separated when 5-point harness was being used. Call mfg. for information and replacement seat.
383)	Ultara 1	420	9/88-7/89	Buckle. Call mfg. for repair info.
384)	Ultara 1	231	2/93-8/93	Plastic sleeve on harness. Call mfg. for repair info.
385)	Ultara II	227	1/90-6/90	Crash test failure. Call mfg. for repair info.
386)	Ultara II	232	2/93-8/93	Plastic sleeve on harness. Call mfg. for repair info.
387)	Fisher Price Car Seat	MODEL	ALL MOD Pre-1987	ELS OLDER THAN 10 YEARS - DESTROY & REPLACE Harness/shield. Call mfg. for repair info.
,	Car Seat	9100, 9101	4/85-1/89	Upholstery. Call mfg. for repair info.
,	Car Seat	9100, 9101	2/90-3/90	Buckle. Call mfg. for repair info.
,	Car Seat	9100	4/85-8/85	Shield. Call mfg. for repair info.
,	Car Seat	9100, 9101	5/87-1/89	Buckle. Call mfg. for repair info.
392)	Car Seat	9100, 9101	2/89-11/89	Buckle (extended 5/87-1/89). Call mfg. for repair info.
393)	Car Seat	9100, 9101	Pre 91	Loose button. Call mfg. for repair info.
394)	Car Seat	9100, 9101	2/91-1/92	Harness/shield. Call mfg. for repair info.
395)	Car Seat	9100, 9101	Pre 7/89	Label on shield. Call mfg. for repair info.
396)	Delux Car Seat	9104	6/15-9/92	Buckle. Call mfg. for repair info.
397)	Infant Seat	9149	1/91-2/91	Shield. Call mfg. for repair info.
398)	Infant Seat	9173	9/94-10-94	Air bag label. Call mfg. for repair info.
399)	Booster	9104	4/92-9/92	Buckle. Call mfg. for repair info.
	Booster Safe Embrace	9104 79700 ODEL	4/92-9/92 5/97-3/98	Buckle. Call mfg. for repair info. Harness adjuster. Call mfg. for repair info.
	Ford			ELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM INUED - DESTROY & REPLACE
402)	Infant Love Seat	All OLD	81/82 ER	Plastic shell may develop cracks. Destroy & replace seat.
	General Motor	r's		ELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM INUED - DESTROY & REPLACE
403)	Infant Love Seat	All	81/82	Plastic shell may develop cracks. Destroy & replace seat.
404)	Child Love Seat	All	3/84-11/84	Plastic shell may develop cracks. Destroy & replace seat.

List No.	Manufacturer Model Name	Model # ("X" = more numbers or letters follow)		r assistance Problem Type and Consumer Action
	Gerry			Evenflo: 800-525-2472 / 800-233-5921
405)	Guardian	All	01/90- 05/90	Buckle. Call mfg. for repair info.
406)	Secure Ride	626 OLD	$1 \square$	Air bag label. Call mfg. for new label
	Graco		800-345-4	1109 / www.gracobaby.com
407)	CarGo	8487x, 8686x, 8689x, 8D01x, 8D02x, 8D03x, 8D04x, 8D05x, 8D10x	01/09/07- 03/03/08	An incorrect NHTSA Hotline telephone number appears on an information label affixed to the back of the seat. Contact mfg. for a replacement label.
408)	ComfortSport	8629x, 8630x, 8631x, 8632x, 8635x, 8639x, 8C00x, 8C01x, 8C02x, 8C03x, 8C04x, 8433x	01/02/07- 07/31/07	Lower Anchorage belt may have been misrouted during assembly process. Use the vehicle seatbelt instead of LATCH to install affected models in the rear-facing position until it is inspected and, if necessary, corrected. Call mfg. or visit gracobaby.com website for additional info.
409)	ComfortSport	8C02MRC2	10/22/07	Seats were produced with foam thicker than specified and tested 1" thick foam. It is unclear as to what impact thicker foam will have on child seat safety. Call mfg. for seat replacement information.
410)	ComfortSport	8C04FRR, 8C04FRR2	11/01/06- 10/08/07 DER	Seats were equipped with a large supplemental "body pillow" that partially obscures the child airbag warning label on the seat pad. Graco will instruct users to discard the supplemental pillows since they are provided for comfort only. Contact mfg. for additional information.
411)	Cozy Cline	All Models	01/01/06- 04/30/10	The harness buckle may become stuck so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. Contact mfg. for replacement buckle.
412)	GT 1000	All	1/85-1/86	Crash test failure. Call mfg. for repair info.
413)	SafeSeat - Step 2	All Models	01/01/06-0 4/30/10	The harness buckle may become stuck so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. Contact mfg. for replacement buckle.
414)	SnugRide	7493, 7497, 7499, 841101, 841102, 841103, 841203, 8412702, 8457, 8459	08/31/99- 02/28/02	May be missing 1 or 2 metal hooks and their retainer pins on the base of the carrier shell or the "U" shaped bars on the carrier shell that are used to attach the carrier to
Ol	LDER	8412T02, 8457, 8458, 8459, 8460, 8462, 8471, 8472, 8473, 8474, 8476, 8477, 8478	LIS	the base. If the hooks, pins or "U" bars are missing, the carrier may not be securely attached to the base and the carrier could detach from the base in the event of a sudden stop or crash. Call Graco to receive a free replacement seat or base. NOTE: All affected model numbers may also begin with the letter "A" and/or also be followed by letters.
415)	SnugRide	8402, 8402L, 8403x, 8412, 8442x, 8443, 8443L, 8444, 8444L, 8446, 8446L, 8447, 8447L, 8448, 8448L, 8457, 8458, 8459, 8463x, 8464, 8470, 8471, 8478, 8601, 8602x, 8603M, 8605x, 8607x, 8608D, C844342	03/01/02- 03/08/03 DER	May have missing hardware used to attach the carrier to the base. Contact mfg. at 866-473-0163 or www.gracobaby.com for inspection and repair information. All models can safely be installed without the base. [NOTE: The initial 03/12/03 recall campaign for this problem included models manufactured through 03/06/03. A recall extension announced 08/13/03 added models manufactured through 03/08/03.]
				OLDER MODEL LIST

List No.	Manufacturer	Model # ("X" = more numbers or letters follow)		r assistance
	Model Name	managers of fetters follow)	wing Date	Problem Type and Consumer Action
	Graco (contin	•		
416)	SnugRide	8609x, 8616x, 8643x, 8645x, 8646x	08/01/06- 06/30/07	The backing of the seat pad may pull away from the seams in an area reachable to the child occupant, exposing the pad filling and posing a potential choking hazard. Contact mfg. For repair kit.
	International			ELS OLDER THAN 10 YEARS - NO LONGER IN BUSINESS - Y & REPLACE
417)	Astroseat	All	12/80-7/81	Buckle. Destroy & replace seat.
	Kolcraft			ELS OLDER THAN 10 YEARS - NO LONGER IN BUSINESS - ST
418)	Automate	180-600, 180-601	Pre 4/93	Buckle. Call mfg. for repair info.
419)	Carter Travel 5	13833, 13842, 13852	5/96-9/96	Crash test failure of buckle. Call mfg. for repair info.
420)	Dial-A-Fit	180-200, 180-300	1/87-8/89	Upholstery clips. Call mfg. for repair info.
421)	Dial-A-Fit	180-200, 180-300	10/88-8/89	Crash test failure. Call mfg. for repair info.
422)	Dial-A-Fit II	180-600	11/90-8/91	Crash test failure. Call mfg. for repair info.
423)	Infant Car Seat	1383x	1/93-6/99	Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
424)	Infant Restraint	43xxx OLD	1/93-6/99	Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
425)	Infant Rider	138xx, 368xx	3/96-8/96	Crash test failure of buckle. Call mfg. for repair info.
426)	Infant Rider	1312x, 1382x, 1383x, 368xx	1/93-6/99	Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
,	Flip 'N' Go	19127 thru 19130	1/85-3/87	Shield. Call mfg. for repair info.
•	Flip 'N' Go II	19127	1/85-3/88	Shield. Call mfg. for repair info R ODEL LIST
,	Perfect Fitt	180-100, 180-150	Pre 4/90	Upholstery clips. Call mfg. for repair info.
•	Perfect Fitt	180-150, 180-200		Crash test failure. Call mfg. for repair info.
,	Perfect Fitt	180-200	Pre 10/90	, , , , , , , , , , , , , , , , , , , ,
	Performa	All 1000	1 10	Upholstery. Call mfg. for repair info.
	Performa Playskool Car Seat	140-155, 180-400		Buckle release force. Call mfg. for repair info. Upholstery. Call mfg. for repair info.
435)	Playskool Car Seat	77001, 77002	1/91-6/93	Buckle. Call mfg. for repair info.
436)	Playskool Infant Car Seat	77005, 77007	1/93-6/99	Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
437)	Plus 4	138xx, 368xx	3/96-8/96	Crash test failure of buckle. Call mfg. for repair info.
438)	Plus 4	1382x, 1383x, 1384x, 368xx	1/93-6/99	Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
439)	Plus 5	138xx, 368xx	3/96-8/96	Crash test failure of buckle. Call mfg. for repair info.
440)	Plus 5	13833, 13842, 13852	5/96-9/96	Crash test failure of buckle. Call mfg. for repair info.

For the model numbers "x" = more numbers or letters follow

11.1	Manuelante	B 4	O l. 1-4	v analistaman
No.	Medal Name	Model # ("X" = more numbers or letters follow)		Rassistance
	Model Name	numbers of fetters follow)	witg Date	Problem Type and Consumer Action
	Kolcraft (cont	inued)		
441)	Plus 5	1382x, 1383x, 1384x, 1385x, 368xx	1/93-6/99	Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
442)	Rock 'N' Ride	13123	2/85-6/85	Plastic shell. Call mfg. to replace seat.
443)	Rock 'N' Ride	131-101	Pre 3/90	Upholstery clips. Call mfg. for repair info.
444)	Secura	43xxx	1/93-6/99	Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
445)	Secure Fit	All	1/96-7/97	Buckle release force. Call mfg. for repair info.
446)	Travel About	138xx, 368xx	3/96-8/96	Crash test failure of buckle. Call mfg. for repair info.
447)	Travel About	13833, 13842, 13852	5/96-9/96	Crash test failure of buckle. Call mfg. for repair info.
448)	Travel-About	1382x, 1383x, 1384x, 1385x	1/93-6/99	Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
449)	Traveler 700	MODEL	11/01/94- 12/31/95	Voluntary action: Buckle concerns. Call mfg. for repair info.
450)	Traveler 700	150-100	1/91-8/91	Cracks in plastic. Call mfg. to replace seat.
451)	Traveler 700	All	1/91-6/93	Rusting of buckle. Call mfg. for repair info.
	Lin Lih/MCP Ent.			ELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM INUED - DESTROY & REPLACE
452)	Lin Lih	All OLL	ALL	Counterfeit seat. Call NHTSA: 800-424-9393
453)	Lin Lih	180-200, 180-300	10/88-8/89	Crash test failure. Call NHTSA: 800-424-9394
	Maxi-Cosi (Dorel)		Dorel Juv www.djgu	renile Group: 866-623-3139 / 800-219-0509 / 866-611-3022 / 812-372-0141
454)	Mico Mico (base)	22-371, 22-372 22-515	07/01/07- 02/17/08	Attachment difficulties between the infant carrier and the base may lead to the carrier being improperly mounted to the base. Contact mfg. for replacement base.
455)	Mico	22-371 HFL, 22-371 JUC, 22-371 LMD, 22-371 ORE,	02/18/08- 06/28/08	Attachment difficulties between the infant carrier and the base may lead to the carrier being improperly mounted to the base. Contact mfg. for repair kit. NOTE:
	Mico (base)	22-371 PNG, 22-372 TTH 22-515 BLK		This is an extension of an earlier recall.
456)	Mico E K	22371x, 22372x	05/01/08- 04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
457)	Priori	22476x, 22486x	05/01/08- 04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
	Mia Moda		866-642-	6632 - www.miamodainc.com
458)	Viva	5000 (seat), 5001 (base)	12/19/06- 02/06/07	The lower anchor connector adjuster assembly may interfere with the connection of the infant carrier to the restraint base when installed using LATCH. Installation with seat belt is not affected. In addition, registration cards were not provided with the Viva or separately sold bases. Contact mfg. For repair kit and to register CR with

mfg.

For the model numbers "x" = more numbers or letters follow

List Manufacturer Model# ("X" = more Customer assistance Model Name numbers or letters follow) Mfg Date Problem Type and Consumer Action Mia Moda (continued) 459) Viva 5000 (seat), 5001 (base), 12/01/06-Sharp edges on the harness splitter plate can cut the harness. Also, the base could 05/31/09 crack in a crash. Contact mfg. at 877-546-8437 for a full refund. Mia Moda is urging 5050 (seat), 5051 (base), Viva Supreme 5070 (seat), 5071 (base) parents/caregivers to discontinue use of the seat until it can be replaced. According 5080 (seat), 5081 (base) to Lerado/Mia Moda, there have been no injuries reported due to these problems and this is a voluntary precaution they are taking. Mercedes-Benz USA 800-367-6372 - www.mbusa.com BQ6910157, BQ6910163 460) Booster 02/01/97-BabySmart airbag deactivation device may not automatically deactivate the passenger airbag. Contact mfg. for free replacement seat and instructional video 07/31/99 02/01/97-BabySmart airbag deactivation device may not automatically deactivate the 461) Infant Restraint BQ6910155 07/31/99 passenger airbag. Contact mfg. for free replacement seat and instructional video. 03/01/03-462) Kiddy TopSafe B66868203 Lower LATCH attachment may not be strong enough to hold in the event of a crash. (mfg. by B66868204 11/30/03 Immediately replace with another model and return Kiddy Top seat to Sicartex) B66868209 Mercedes-Benz dealer for refund. Install with vehicle seat belt until replacement is obtained. Contact Mercedes-Benz for further information. Peg Perego USA 877-737-3468 / 219-482-8191 - www.perego.com IMCB00JA57RJ31JU31 07/01/07-0 The plastic adjustment cover of affected models could have exposed sharp edges 463) Jacadi 3/14/08 that could cause cuts, scratches, or abrasions on the feet or legs of bare-footed infants. Does not affect safety as car seat. Contact mfg. for a free repair kit. 02/01/01-464) Primo Viaggio CS00MU1, CS00US The latch mechanism securing the seat to the base does not completely engage on 06/10/01 a small number of seats due to improper positioning of the metal reinforcement CS00US8 bracket. Call mfg. for repair info. Note: Primo Viaggio infant seat sold separately and with strollers as part of Pliko and Primo Viaggio Travel Systems. 465) Primo Viaggio CS00MU1, CS00US1, 05/20/01-The harness adjustment/locking mechanism may not fully lock and allow the harness to slip. The strap tension adjuster cover of affected models have a red circle-CS00US8, LV34USL, 02/15/02 around a dark button. Contact mfg, for full identification and repair information. Note: LV34USN, LN34S09, LN34S10, ST33USL. Primo Viaggio infant seat sold separately and with strollers as a part of Pliko, Primo ST33USN, ST38USL, Viaggio, and Atlantico Travel Systems. ST38USN, AL33USL, AL33USN, AL34USN, AL34USL 32MD41KN41, 35CR13BU13. 66) Primo Viaggio 07/01/07-0 The plastic adjustment cover of affected models could have exposed sharp edges 35CR13PL46, 35CR24BU24, SIP 30/30 3/14/08 that could cause cuts, scratches, or abrasions on the feet or legs of bare-footed 35TL49KN53, 35TL53KN46, infants. Does not affect safety as car seat. Contact mfg. For a free repair kit. 61FG13ST53, 61FG53ST49, Note: Affected model numbers begin with IMUN00US. 61FG53ST64, 61ST13IC53, 61ST34IC53, 61ST48IC53 Contact Kolcraft: 800-453-7673 Playskool 467) Car Seat 140-155, 180-400 12/89-8/90 Upholstery. Call Kolcraft 468) Car Seat 77001, 77002 1/91-6/93 Buckle. Call Kolcraft 469) Infant Car Seat 77005, 77007 1/93-6/99 Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.

Page 17 of 31

List Manufacturer Model # ("X" = more No. Model Name numbers or letters follow)		Customer assistance Mfg Date Problem Type and Consumer Action				
	Pride Trimble/Virco		800-521-5	800-521-5198		
470)	Click-n-Go	890, 891, 892	2/86-10/87	Crash test failure. Call mfg. to replace seat.		
471)	Click-n-Go	890, 891, 892	1/88-4/89	Crash test failure. Call mfg. to replace seat.		
472)	Pride Ride	832 OLL	1/88-4/89	Crash test failure. Call mfg. to replace seat.		
	Questor		Contact E	Evenflo: 800-233-5921		
,	Kantwet Car	All	5/69-3/73	May pinch child's fingers. Call mfg. for repair info.		
	Recaro		888-973-2	276 / 800-873-2276 / 248-364-3818/ - www.recaropromotion.com		
474)	Como	331.00.xxx	Pre- 09/17/07	Consumer Advisory - Not a Recall: Lap and shoulder belt guide (previously referred to as "lock-off") may not hold belt webbing snugly enough to prevent belt from loosening. Contact mfg. for locking clip and instructions included as a part of the		
475)	Como ER	331.00.xxx DEL	Pre- 12/18/07	Consumer advisory. The harness may become disconnected from the harness connector when a child is placed in or removed from the child seat. Contact mfg. for repair kit.		
476)	Como	331.00.xxx, 331.01.xxx	11/01/07- 02/16/09	The front harness adjuster strap may slip within the adjuster/lock that controls tightness of the harness and may prevent the harness from staying properly tight. Contact mfg. for free replacement seat. NOTE: Models with a green dot above the		
477)	Signo	331.00.xxx OLD	Pre- 12/18/07	bar code on the model # sticker are OK to use. The harness may become disconnected from the harness connector when a child is placed in or removed from the child seat. Contact mfg. for repair kit.		
478)	Signo	330.00.xxx, 330.01.xxx	11/01/07- 02/16/09	The front harness adjuster strap may slip within the adjuster/lock that controls tightness of the harness and may prevent the harness from staying properly tight. Contact mfg. for free replacement seat. NOTES: This date range is an expansion of the initial date range (02/01/08-09/30/08)for this recall. Models with a green dot above the bar code on the model # sticker are OK to use.		
Renolux (FBS)			ELS OLDER THAN 10 YEARS - NO LONGER IN BUSINESS - Y & REPLACE			
479)	GT 1000	All	8/88-10/88	Buckle/recline angle. Destroy & replace seat.		
480)	GT 2000			Buckle/recline angle. Destroy & replace seat.		
	GT 2000	All	1/92-1/93	Foam padding failed HIC (head injury) limits. Destroy & replace seat.		
482)	GT 2000	All	5/89-6/93	Flammability of upholstery. Destroy & replace seat.		
483)	GT 4000	All	1/92-1/93	Foam padding failed HIC (head injury) limits. Destroy & replace seat.		
484)	GT 4000	All	5/89-6-93	Flammability of upholstery. Destroy & replace seat.		
485)	GT 5000	All ULL	1/92-1/93	Foam padding failed HIC (head injury) limits. Destroy & replace seat.		
486)	GT 5000	All	5/89-6-93	Flammability of upholstery. Destroy & replace seat.		
,	GT 5000 Turn A Tot	All	2/90-4/91	Test failure/upholstery. Destroy & replace seat.		
,	GT 5000 Turn A Tot	All	1/92-1/93	Foam padding failed HIC (head injury) limits. Destroy & replace seat.		

For the model numbers "x" = more numbers or letters follow

No.	Manufacturer Model Name	Model # ("X" = more numbers or letters follow)		Customer assistance Mfg Date Problem Type and Consumer Action		
	Renolux (FBS) (continued)			wig Date Problem Type and Consumer Action		
489)	GT 5000 Turn A Tot	All	5/89-6-93	Flammability of upholstery. Destroy & replace seat.		
,	GT 5500 GT 5500	All OLD	1/92-1/93 5/89-6-93	Foam padding failed HIC (head injury) limits. Destroy & replace seat. Flammability of upholstery. Destroy & replace seat.		
,	GT 7000	All	All	Remote may overheat/ fire hazard. Destroy & replace seat.		
,	GT 7000	All	1/92-1/93	Foam padding failed HIC (head injury) limits. Destroy & replace seat.		
,	GT 7000	All	5/89-6-93	Flammability of upholstery. Destroy & replace seat.		
,				OLDER MODEL LIST		
	Safeline Kids		800-829-1	800-829-1625 - www.tripleplayproducts.com		
495)	Sit'n'Stroll	3240	6/9/97- 8/9/97	Air bag labels. The air bag warning label was omitted from the seat cover. Contact Mfg. for new seat cover that has the required air bag warning label.		
496)	Sit'n'Stroll	MODEL 3240	11/1/96-6/30/99	Labels recommend use rear-facing for children up to 25 pounds. Contact Mfg. for new labels to be placed over the existing labels. New labels recommend use rear-facing for children up to 22 pounds.		
497)	Sit'n'Stroll	2240	04/01/01- 10/01/01	The FAA certification statement on label is in yellow lettering instead of the required RED lettering. Flight attendants may not allow its use on an airplane. Contact mfg. for replacement label.		
498)	Sit'n'Stroll		09/01/02- 10/21/03	Child's head may move too far forward in a crash when lower forward-facing belt path or shoulder and buckle pads are used. Remove and discard shoulder and buckle pads and use upper forward-facing belt path only. Contact mfg. for revised instructions and labels.		
	Safety 1st (Dorel)		Dorel Juv	venile Group: 866-623-3139 / 800-219-0509 / 866-611-3022 / 812-372-0141		
		,	www.djgu	ISA.COM		
499)	Alpha Elite	All Models	www.djg u 11/01/03- 12/31/05	Isa.com There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.		
·	Alpha Elite Alpha Omega Alpha Omega Elite	•	11/01/03-	There is a potential for the harness adjustment strap to loosen during use. Contact		
500)	Alpha Omega Alpha Omega	All Models 22151	11/01/03- 12/31/05 11/01/03- 12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit. There is a potential for the harness adjustment strap to loosen during use. Contact		
500)	Alpha Omega Alpha Omega Elite Alpha Omega All-N-1 Alpha Omega	All Models 22151 22455 22152x, 22159x, 22172x, 22177x, 22178x, 22185x, 22188x, 22195x, 22412x,	11/01/03- 12/31/05 11/01/03- 12/31/05 05/01/08-	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit. There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit. Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit. The rear-facing belt path installation arrows are incorrect, possibly appearing to point toward the forward-facing vehicle belt path location. Contact mfg. for		
500) 501) 502)	Alpha Omega Alpha Omega Elite Alpha Omega All-N-1 Alpha Omega Elite Alpha Omega	All Models 22151 22455 22152x, 22159x, 22172x, 22177x, 22178x, 22185x, 22188x, 22195x, 22412x, 22456x, 22465x, 22469x 22187xxx, 22465xxx,	11/01/03- 12/31/05 11/01/03- 12/31/05 05/01/08- 04/30/09 07/20/10-	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit. There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit. Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit. The rear-facing belt path installation arrows are incorrect, possibly appearing to		
500) 501) 502) 503)	Alpha Omega Alpha Omega Elite Alpha Omega All-N-1 Alpha Omega Elite Alpha Omega Elite	All Models 22151 22455 22152x, 22159x, 22172x, 22177x, 22178x, 22185x, 22188x, 22195x, 22412x, 22456x, 22465x, 22469x 22187xxx, 22465xxx, CC033xxx, CC046xxx	11/01/03- 12/31/05 11/01/03- 12/31/05 05/01/08- 04/30/09 07/20/10- 05/18/11	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit. There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit. Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit. The rear-facing belt path installation arrows are incorrect, possibly appearing to point toward the forward-facing vehicle belt path location. Contact mfg. for replacement label kit. There is a potential for the harness adjustment strap to loosen during use. Contact		

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

Page 20 of 31

List No.	Manufacturer Model Name	Model # ("X" = more numbers or letters follow)		Problem Type and Consumer Action	
	Safety 1 st (Dorel) (continued)				
505)	Complete Air LX Complete Air SE	CC050xxx CC051xxx	07/20/10-0 5/18/11	The rear-facing belt path installation arrows are incorrect, possibly appearing to point toward the forward-facing vehicle belt path location. Contact mfg. for replacement label kit.	
506)	Designer 22	02-621-SAL, 02-620-xxx	01/03/02- 02/13/02	Plastic handle can unexpectedly release from the carrying position when used as a carrier. Does not affect safety as a child restraint. Contact mfg. for repair kit.	
507)	Designer 22	22-325 xxx GB1B	08/19/03- 10/20/04	Harness can loosen if not properly tightened. Contact mfg. for free repair kit. Parents should continue to use the seat while waiting to receive/install the repair kit but are advised to make sure that the seat is properly adjusted while in use. NOTE: Models involved were sold only as travel systems (with a stroller) and any line code other than GB1B in the model # is not included in the recall.	
508)	Enspira	22450, 22451, 22452, 22453, 22480, 22481	11/01/03- 12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.	
509)	Enspira DER	22453x ODEL	05/01/08- 04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.	
510)	Infant Car Seat	22-057 CLN, 22-057 DBY, 22-057 HRT, 22-057 LPH, 22-085 DWA, 22-085 LYN, 22-095 RBK, 22-322 HRR, 22-322 KDL, 22-322 LXI, 22-322 MAI, 22-322 OLY, 22-322 PRS, 22-322 PTK, 22-325 COB, 22-325 PAC, 22-380 LGA, 22-380 MSA, 22-627 WAV	01/06/08- 04/06/09	The child restraint carry handle can loosen and come off posing a fall hazard to infants. The safety as a child restraint is not affected. Do not use handle until repaired. Contact mfg. for free repair kit. NOTE: Only those models sold as a part of the Eurostar, Explorer, Lite Wave, Sojourn, and Vector Travel Systems are affected.	
511)	Intera	22460	11/01/03- 12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.	
512)	OnBoard	22077x, 22078x, 22356x	05/01/08- 04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.	
513)	Prospect	22580X ODEL	05/01/08- 04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.	
514)	Uptown	22475x	05/01/08- 04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.	
515)	Vantage Vantage Point/ Surveyor Vantage Hiback	22553x, 22554x, 22560x, 22561x, 22564x, 22567x, 22574x	05/01/08- 04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.	
	Snug Seat		800-336-7	684 - www.snugseat.com	
516)	Gorilla	200-1000	07/26/02- 01/15/03	A washer in tether anchor kit does not meet corrosion requirements of FMVSS 213. Contact mfg. for replacement kit # FW-50250-12-ZY	

Page 21 of 31

For the model numbers "x" = more numbers or letters follow

List Manufacturer Model # ("X" = more Customer assistance No. Model Name numbers or letters follow) Mfg Date Problem Type and Consumer Action Snug Seat (continued) 600-1000 517) Spelcast 07/26/02-A washer in tether anchor kit does not meet corrosion requirements of FMVSS 213. 01/15/03 Contact mfg. for replacement kit # FW-50250-12-ZY E9L32 Pre-The adjuster strap may slip within the metal buckle that controls the tightness of the 518) Traveller Plus 07/24/04 shoulder harness and may allow the harness to loosen. Contact Britax at 800-683-(Mfg. by Britax for Snug Seat) 2045 or 704-409-1700 for repair kit. Strolee ALL MODELS OLDER THAN 10 YEARS - NO LONGER IN BUSINESS -**DESTROY & REPLACE** ΑII Pre 4/80 519) Wee Care Crash test failure. Destroy & replace seat 599 12/80-5/81 Upholstery. Destroy & replace seat. 520) Wee Care 521) Wee Care 609, 610 ALL Plastic shell. Destroy & replace seat. ALL 522) Quick Click 605 Plastic shell. Destroy & replace seat. 523) GT 3000 87/88 Crash test failure. Destroy & replace seat. Team-Tex America 877-912-1313 524) Babyride 374099 08/31/06-Belt routing label with "horizontal reference line" was incorrectly placed on the CR. Contact mfg. for a correct label and placement instructions. NOTE: According to 10/23/06 Team-Tex America, all seats that were affected by this recall were caught and corrected before being purchased by consumers and thus should not be found in The belt routing label with the "horizontal reference line" for determining the correct 525) Babyride 374199 12/18/08 recline angle is incorrectly placed on the child restraint. Contact mfg. for replacement label and instructions. TriplePlay Products 800-829-1625 - www.tripleplayproducts.com (See Safeline Kids also) 526) Sit'n'Stroll 4002 05/05/08 The webbing used in the center adjuster for the harness fails to comply with the initial breaking strength requirements of FMVSS 213. Contact mfg. for repair kit and instructions. NOTE: According to TriplePlay, the only units affected were a small number of seats manufactured on May 5, 2008 and sold through their website. All purchasers are being contacted and notified of this recall. **TRW** ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM **DISCONTINUED - DESTROY & REPLACE** 81/82 527) Infant Love ΑII Plastic shell may develop cracks. Destroy & replace seat. Seat 3/84-11/84 Plastic shell may develop cracks. Destroy & replace seat. 528) Child Love Seat All Volvo 800-458-1552 / 800-221-9136 / 201-768-7300 529) ALL SEATS Thru 12/88 Buckle. Call mfg. for refund info. ΑII

For the model numbers "x" = more numbers or letters follow

List Manufacturer Model # ("X" = more Customer assistance
No. Model Name numbers or letters follow) Mfg Date Problem Type and Consumer Action

XSCi

530) Pioneered None*

800-630-6850 / 719-593-8881

02/01/02-03/07/02 DER Exceeds the maximum head excursion criteria of FMVSS 213. In a crash, the cradle can detach from the deflector base. Contact mfg for replacement information (replacements produced by an alternate mfg.) *No model number is associated, but affects serial numbers 01C-000000002 to 01C-000000108. [NHTSA No.: 02E-024] **NOTE: According to XSCi, all seats that were affected by this recall have been returned (as of May 8, 2002) and thus should not be found in use.*

OLDER MODEL LIST

OLDER MODEL LIST

OLDER MODEL LIST

OLDER MODEL LIST

OLDER MODEL LIST

OLDER MODEL LIST

OLDER MODEL LIST

Index of Recalls and Safety Notifications for Older odel List For the model numbers "x" = more numbers or letters follow.

Model numbers and model names for car seats under recall are followed by their index number which corresponds to the "List No." for each listing. If the model number is not found, check the model name also. Model numbers are not available for all model names.

Note: Dorel Juvenile Group products are indexed under each individual product line (e.g., Cosco) as well as under "Dorel."

OL	.DER MODEL L	IST
Alcot (Childcare)	Basic Comfort	Advantage
Child Love Seat 201	# 960	Boulevard 222
	# 961	Chaperone
All Our Kids	Galaxy 2000 216, 217	Companion
# 600	Participation (Parti)	Decathlon. 227 Freeway
# 602	Beatrix Potter (Dorel) # 02-620-xxx	Freeway
Little Cargo Vest 202, 203	# 02-621-SAL	Husky
Alpha Elite (Dorel)	Designer 22	Marathon
# 22148x 205		Regent
# 22149x 205	Bertini (Dorel)	Roundabout
# 22158x	# 22346x	Super Elite
# 22331 BLA	SureFit	Traveller Plus
# 22332 RLA	D-16 0	Wizard
# 22459x	Bolform Corp. # 84E-019220	Century
Alpha Luxe	Buckle-Up Harness	# 11-564
Alpha Omega All-N-1	Buone of Hamood	# 11-565
Alpha Omega Elite	Britax D \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \	#11-570259, 260
Comfort Infant Seat 206, 207	Britax #101RV.O.D.E.L. 228.	#11-575
	# 161	# 11-576 260
Alpha Sport (Dorel)	# E902228	# 11-578
# 22452x	# E9031	#11-595
# 22546x	# E906	# 11-597
# 22547x	# E9L07	# 11-599
Enspira	# E9L14	# 11-598
Vantage	# E9L20	# 11-650 259
	# E9L30 231, 232, 233	# 12-565 279
American Motors	# E9L32	# 4100
Child Love Seat	# E9L3998	# 4153
Infant Love Seat	# E9L39X	# 4180
Baby Trend # 6400	# E9L39x. 235 # E9L47. 227 # E9L5490. 230	# 4200
# 0400	# E9L54E7	# 4210
# 6439	# E9L54H6	# 4214 245, 246, 247, 248
# 6448	# E9L54H7229	# 4223 245, 246, 247, 248
# 6481	# E9L54M6	# 4235 245, 246, 247, 248
Rigid Latch-Loc. 212 Rigid Latch-Loc Base. 213	# E9L57	#4253 249, 250, 251
Rigid Latch-Loc Base	# E9L57	# 4261
Babyhood Industries	# E9L692L	# 4265
#810214	# E9L692M	# 4266
# 8200	# E9L69P2 223	# 4300
Baby-Sitter	# E9L69P3	# 4302
Wonda Chair	# E9L69P5	# 4303. # 4310
	# E9L80	# 4310/ /
	# E9W06 234	# 4323

For the model numbers "x" = more numbers or letters follow Index number refers to "List No." for each listing Century (continued) 252 Compass Baby # I420 ARD..... # 4366. 253, 254, 255, 256, 257 # I420 MAR..... 293 # 4750. # 4875. # 4885. Cosco # 02-014-EMF..... # 02-015-PDL.... # 02-084..... 320. 323 # 02-0901 317 # 02-094 323 # 02-096 323 300..... # 4450. 263, 264, 266, 267 # 4460. 263, 264, 265, 266, 267 # 02-190..... 319 # 02-290..... 318 5000 STE...... 263, 264, 265, 266, 267 # 02-331..... 294 # 02-332..... 294 5500 STE..... # 02-404..... 323 580..... 269, 270 Affinity...... # 4475. 263, 264, 265, 266, 267 # 02-531..... 294 # 02-537..... 294

 Child Love Seat.
 276

 Encore.
 277

 Infant Car Seat.
 278, 279

 # 02-584-OXF..... 280 # 02-665..... 280 # 02-667..... # 02-719 ARQ..... # 02-727..... Smart Fit..... # 02-728..... # 02-729..... 301 Chicco 300 # All.....Cortina Travel System. 301 # 02-733..... # 02-751..... 299. 301 # 02-753..... Chrysler Child Love Seat. # 02-755..... 279 Collier-Keyworth # 02-757..... 301 # 02-758..... Co-Pilot..... Commuter..... Safe and Sound II..... # 02-760..... # 02-761..... # 02-762..... #8065. R. V.ODEI # 02-763 290 # 4575. 272, 279 # 02-770..... 328 # 02-771..... 328 # 8815. Avatar. 292 # 02-774 # 02-790 289 # 02-821..... 323

Index number refers to "List No." for each listing For the model numbers "x" = more numbers or letters follow Cosco (continued) # 02014. DE.R. IVI 324 # 93100x..... 326 326 307 308 325 Alpha Omega. 294, 295, 296

 Alpha Omega All-N-1.
 298

 Alpha Omega Elite.
 296, 297

 Arriva.
 299, 300, 301

 Commuter..... 303 # 02-620-xxx (Beatrix Potter). 218 # 02-620-xxx (Safety 1st)........... 506 # 02-621-SAL (Beatrix Potter). 218 # 02-621-SAL (Safety 1st). 506 Lxry Sft Shld Auto Trac..... 310 Safe-T Mate. 313
Safe-T-Shield. 312
Sff Shld Auto Trac. 318 324 324 # 02-751 (Cosco). 299, 301 Touriva. . . . 320, 321, 322, 323, 324, 325, 326 301 Voyager Inf/Stroller..... # 22-297...... 309 Cybex (Regal Lager) # 0500200xx..... # 22-299...... 309 330 # 22-300 CSF..... 302 # 0500760xx..... # 22-300 FZN..... 302 Disney (Dorel) 302 # 22-305 NAB.... 302 # 22-305 PPH..... # 22-300-JOS GB1B..... # 22100x..... 326 # 22130x..... Dorel # 22150x..... 298 # 22154x..... 297 # 22155x..... 297 # 02084 (Cosco).... # 22158x..... 297

April 5, 2021

Page 26 of 31 Index number refers to "List No." for each listing

• •	SAFETY NOTIFICATIONS: WIODELS TO YEARS	•
For the model numbers "x" = more numbers or letters follows:	OW	Index number refers to "List No." for each listing
Dorel (continued) # 22	2-305 NAB (Disney)	# 22185x (Safety 1st)501
# 09222 (Conso) 205 # 22		
# 02332 (Cosco)	2-305 PPH (Disney)	# 22187xxx (Safety 1st) 502
# 02409 (Cosco) # 22	2-322 HRR (Safety 1st) 510	# 22188x (Safety 1st)
	2-322 KDL (Safety 1st) 510	# 22195x (Safety 1st) 501
# 02442 (Cosco)	2-322 LXI (Safety 1st) 510	# 22269 (Cosco)
# 02442 (Eddie Bauer) 343 # 22	2-322 MAI (Safety 1st) 510	# 22331 BLA (Alpha Elite) 206, 207
# 02443 (Cosco)	2-322 OLY (Safety 1st) 510	# 22332 RLA (Alpha Elite) 206, 207
	2-322 PRS (Safety 1st) 510	# 22346x (Bertini)
# 02445 (Cosco) 307 # 23	0_322 PTK (Safety 1st) 510	# 22356x (Safety 1st)
# 02445 (Eddie Bauer)	2-325 COB (Safety 1st)	# 22371x (Maxi-Cosi)
# 02448 (Cosco)	2-325 PAC (Safety 1st) 510	# 22372x (Maxi-Cosi)
# 02448 (Eddie Bauer)	2-325 xxx GB1B (Safety 1st)	# 22412x (Safety 1st)
	2-355 LBF (Disney)	# 22439x (Safety 1st)
	2-355 PWK (Disney)	# 22449x (Safety 1st)
# 02450 (Cosco)	2-371 (Eddie Bauer) 454	# 22450 (Safety 1st) 508
# 02450 (Eddie Bauer) 343 # 22	2-371 HFL (Maxi-Cósi) 455	# 22451 (Safety 1st) 508 # 22452 (Safety 1st) 508
# 02480 (Cosco)	2-371 JUC (Maxi-Cosi) 455	# 22452 (Safety 1st) 508
	2-371 LMD (Maxi-Cosi) 455	# 22452x (Alpha Sport)
	2-371 ORE (Maxi-Cosi)	# 22453 (Safety 1st) 508
	2-371 PNG (Maxi-Cosi)	# 22453x (Safety 1st)
	2-372 (Eddie Bauer)	# 22455 (Safety 1st)
# 02514 (Cosco) 324 325 # 23	2-372 TTH (Maxi-Cosi)	# 22456x (Safety 1st)
# 02518 (Cosco)	2-380 LGA (Safety 1st) 510	# 22458x (Alpha Sport)
# 02519 (Cosco)	2-380 MSA (Safety 1st) 510	
		# 22459x (Alpha Elite)
	2-515 (Eddie Bauer)	# 22460 (Safety 1st)
	2-515 BLK (Maxi-Cosi)	# 22462x (Alpha Elite)
	2-625 xxx GB1B (Eddie Bauer) 340	# 22465x (Safety 1st)
	2-627 AWF (Disney)	# 22465xxx (Safety 1st) 502
# 02555 (Cosco)	2-627 CGT (Eddie Bauer) 344	# 22469x (Safety 1st) 501
# 02584 (Cosco)	2-627 FRK (Eddie Bauer) 344	# 22475x (Safety 1st) 514
# 02803 (Cosco)	2-627 KGS (Eddie Bauer) 344	# 22476x (Maxi-Cosi)
# 02806 (Cosco)	2-627 SNW (Eddie Bauer) 344	# 22480 (Safety 1st) 508
# 02821 (Cosco)	2-627 WAV (Safety 1st) 510	# 22481 (Safety 1st) 508
# 02825 (Cosco)	2-627 WPR (Eddie Bauer) 344	# 22486x (Maxi-Cosi)
# 02870 (Eddie Bauer)	2-655 BYTE (Eddie Bauer) 344	# 224x (Cosco)
# 02871 (Eddie Bauer)	2077x (Safety 1st)	# 22546x (Alpha Sport)
# 02875 (Eddie Bauer)	2078x (Safety 1st) 512	# 22547x (Alpha Sport) 209
# 02935 (Cosco)	2100 (Cosco)	# 22553x (Safety 1st) 515
# 181A (Cosco)	2100x (Cosco)	# 22554x (Safety 1st)
	2111x (Cosco)	# 22560x (Safety 1st)
	` '	
	2130x (Cosco)	# 22561x (Safety 1st)
# 22-001FSM (Cosco)	2139MON (Cosco)	# 22564x (Safety 1st)
	2148x (Alpha Elite) 205	# 22567x (Safety 1st)
# 22-057 DBY (Safety 1st) 510 # 22	2149x (Alpha Elite) 205	# 22574x (Safety 1st)
	2150 (Cosco)	# 22580x (Safety 1st)
	2150x (Cosco)	# 225x (Cosco)
	2151 (Safety 1st)	# 22630xxx (Eddie Bauer)
# 22-085 LYN (Safety 1st) 510 # 22	2152x (Safety 1st) 501	# 22631xxx (Eddie Bauer)
# 22-095 RBK (Safety 1st) 510 # 22	2154x (Cosco)	# 22657x (Eddie Bauer)
# 22-297 (Cosco)	2155 (Cosco)	# 22740 (Eddie Bauer)
# 22-298 (Cosco)	2155 (Cosco)	# 22740x (Eddie Bauer)
	2158x (Alpha Elite) 205	# 22741x (Eddie Bauer)
	2158x (Cosco)	# 22750 (Eddie Bauer)
	2159x (Safety 1st)	# 22755 (Eddie Bauer)
	2172x (Safety 1st)	# 22755x (Eddie Bauer)
		# 22755 (Eddie Bauer)
	2177x (Safety 1st)	
# 22-300 THD (Cosco)	2180 (Cosco)	# 22757 (Eddie Bauer)
# 22 300 IOS CB1B (Cossa) 204	2100 (00800)	# 221 JOX (Eudle Dauer)
# 22-300-JOS GB1B (Cosco) 304		

Index number refers to "List No." for each listing For the model numbers "x" = more numbers or letters follow Dorel (continued) Enspira (Eddie Bauer). 341, 342 Enspira (Safety 1st). 508, 509 Hi Back Booster (Cosco). Hi Back Booster (Eddie Bauer)..... High Rise Booster (Cosco)........... 309 # 22-627 CGT..... 344 # 229x (Cosco)..... 327 Infant Car Seat (Eddie Bauer). 344 # 22-627 FRK..... 344
 Infant Car Seat (Safety 1st).
 510

 Intera (Safety 1st).
 511

 Lxry Sft Shld Auto Trac (Cosco).
 310
 # 244x (Cosco)..... # 22-627 KGS..... 344 315 # 323 (Cosco)..... # 22-655 BYTE..... OnBoard (Safety 1st). 512 # 81A (Cosco)..... 312 Priori (Maxi-Cosi). 457 # 81B (Cosco)..... 312 Prospect (Safety 1st). 513 # 22657x..... 346 Prospect Adjustable Hiback Booster (Eddie Regal Ride (Cosco). 311 # 22755x..... 338 # 22758x..... 338 # 22759x..... 338 Soft Shield Deluxe (Cosco). 319 # CC046xxx (Safety 1st)..... 502 # CC050xxx (Safety 1st)..... 505 # 22790x..... 338 # CC051xxx (Safety 1st)..... 505 SureFit (Eddie Bauer)..... # 22790xxx..... 339 # 22799x..... 338 # 22880x..... 345 Touriva Shield (Cosco)..... # IC072x..... Alpha Omega (Cosco). 294, 295, 296 Touriva T-Shield (Cosco). 323 Alpha Omega (Eddie Bauer). 335 Alpha Omega (Safety 1st). 500

 Comfort Infant Seat.
 336, 337

 Deluxe 3-in-1.
 334, 338, 339

 Deluxe Convertible.
 334

 Uptown (Safety 1st). 514
Vantage (Alpha Sport). 209
Vantage (Safety 1st). 515 Alpha Omega All-N-1 (Alpha Elite)..... 205 Alpha Omega All-N-1 (Cosco). 298 Alpha Omega All-N-1 (Safety 1st). 501 Alpha Omega Elite (Alpha Elite)......... 205 Vantage Highback (Safety 1st)..... 515 Alpha Omega Elite (Cosco). 296, 297 Vantage Point/Surveyor (Safety 1st). . . . 515 Alpha Omega Elite (Eddie Bauer). 335 Alpha Omega Elite (Safety 1st). 500, 501, 502 Downunder Prospect Adjustable Hiback Booster. 345 Kangaroo Booster..... Avenue (Safety 1st). 504 Eddie Bauer Comfort Infant Seat (Alpha Elite). . . . 206, 207 # 02-331..... Evenflo Comfort Infant Seat (Eddie Bauer)... 336, 337 # 200x...... 368 # 02-531. # 02-533. # 02-537 Complete Air LX...... Deluxe 3-in-1 (Eddie Bauer).... 334, 338, 339 # 203x..... 365 # 02-555.... Deluxe Convertible (Eddie Bauer). 334 # 205x..... 365, 376, 377 # 207x..... 367 # 210x...... 365, 377 Designer 22 (Eddie Bauer)............ 340 # 211x..... 368 Designer 22 (Safety 1st)......... 506, 507 # 02448. # 02449.

For the model numbers "x" = more numbers or lett	Index number refers to "List No." for each listing	
Evenflo (continued)	# 445	Trooper 327, 381
# 219x	# 446	Two-in-One
#219X	# 447	Ultara 1
# 222	# 448	Oldid III
# 223	# 453	Fisher Price
# 224x	# 454	# 79700
# 227	# 458	394, 395
# 228	# 458. # 468x. # 469x. 356	394, 395 # 9101 388, 389, 391, 392, 393, 394, 395
# 229x 327, 355, 372, 373	# 469x 356	# 9104
# 231	# 470	# 9149
# 242	# 476x	Booster
# 244x	# 477x	Car Seat 387, 388, 389, 390, 391, 392, 393,
# 264x	# 478x	Delux Car Seat
# 273x	# 481x	Infant Seat
# 3021769Z	# 492x 367	Safe Embrace
# 3021854Z	# 493x	Ford
# 31011049	# 534	Infant Love Seat
# 31011049	# 540xx	
#31011059	# 548xx	General Motors
# 3101198	# 549xx	Child Love Seat. 404 Infant Love Seat. 403
# 317xx	# 552	mant 2010 Codt
# 320xx	# 556xx	Gerry
# 359x	# 597xx	# 626
# 378x	# 597xx	Secure Ride
# 379x 378	# 636x 382	
# 389x	# 637x	Graco # 7493 414
# 391	# 639002	# 7497 414
# 397xx 361	410	# 7499
# 398xx	Bobby Mac Champion	#8402/1
# 401	Booster Seat	# 8403x
# 403	Champion	# 841101 414
# 404	Cozy Carry	# 841102
# 405	Discovery	# 841103
# 406 # 407	Embrace	# 841203 414
# 408	First Choice	# 8412T02
# 409	Infant Car Seat. 363, 364 Joyride. 365	# 8433x
# 411	Maestro	# 8443
# 412	On My Way 367, 368	# 8443L
# 414	On My Way base	# 8444
# 416	One-Step 370 One-Step Deluxe 371	# 8446
# 4176	Scout	# 8446L 415
# 420	Seven Year Seat	# 8447
# 435x	Sidekick	# 8447L
# 442	Tribute	# 8448
# 443	Triumph	# 8457/ I
# 444		# 8458 414, 415

For the model numbers "x" = more numbers or letters follow Index number refers to "List No." for each listing Graco (continued) Kolcraft Maxi-Cosi # 131-101.... 443 # 22-371..... # 22-371 HFL..... 455 # 22-371 JUC..... 455 # 1382x..... 426, 438, 441, 448 # 22-371 LMD..... 455 # 22-371 ORE...... 455 # 13833. 419, 440, 447 # 1383x..... 423, 426, 438, 441, 448 # 8471. 414. 415 # 13842. 419, 440, 447 # 22-372...... 454 # 22-515...... 454 # 138xx...... 425, 437, 439, 446 # 22371x..... 456 # 140-155..... 434 # 22372x..... 456 # 150-100...... 450 # 8478. 414. 415 # 22476x..... 457 # 180-100..... 429 # 8602x..... 415 # 180-300...... 420, 421 # 8603M..... 415 # 8605x..... 415 # 180-400..... 434 Mercedes-Benz # 8607x..... 415 # 180-600..... 418, 422 # 8608D. 415 # 180-601..... 418 # 8609x...... 416 # BQ6910157..... 460 # 8630x..... 408 # 8631x..... 408 # 368xx.... 425, 426, 437, 438, 439, 441, 446 # 8632x..... 408 # 43xxx..... 424, 444 # 8635x..... 408 # 77002. 435 # 77005. R. V. ODE L. 436 # 77007. 436 416 Mia Moda # 8646x..... 416 # 8686x..... 407 # 8689x..... 407 Flip 'N' Go. 427 Flip 'N' Go II. 428 Infant Car Seat. 423 #5071. #5080./10DEL LIS #5081 # 8C04FRR..... 410 Viva Supreme..... # 8C04FRR2..... 410 Perfect Fitt. 429, 430, 431 Peg Perego Performa..... 432, 433 #8D01x. #8D02x.DER.MOI 407 407 Playskool Infant. 436 # 35CR13PL46...... 466 # 35TL49KN53...... 466 Secure Fit..... # 61FG13ST53...... 466 CarGo......... ComfortSport. 408, 409, 410 Cozy Cline. 411 Traveler 700...... 449, 450, 451 GT 1000..... 412 SafeSeat - Step 2...... 413 Lin Lih/MCP SnugRide. 414, 415, 416 # AL33USL..... 465 # AL33USN...... 465 # 180-300..... 453 # AL34USL 465 # AL34USN 465 International Astroseat. 417 # CS00MU1...... 464, 465, 466

For the model numbers "x" = more numbers or letters follow Index number refers to "List No." for each listing # 22475x.... Peg Perego (continued) Safeline Kids # 3240. 464, 465 464, 465 463 # 22553x..... 515 Safeline Kids (see Triple Play also) # 22554x..... 515 # 22560x..... 515 # LV34USL..... # 22561x..... 515 # LV34USN..... # 22564x..... 515 # ST33USL..... # 22567x..... 515 465 # 22574x..... 515 465 # 22580x..... 513 # ST38USL..... # 02-621-SAL.... Jacadi..... 463 # 22-057 CLN..... Primo Viaggio...... 464, 465 # 22-057 DBY..... Primo Viaggio SIP 30/30. 466 Playskool # 180-400...... 467 # 22-085 LYN..... 510 Alpha Omega All-N-1..... 501 # 22-095 RBK..... 510 Alpha Omega Elite. 500, 501, 502 # 22-322 HRR...... 510 Alpha Sport..... 503 # 22-322 KDL..... 510 Avenue..... 504 # 22-322 LXI..... 510 Complete Air LX. 505 Designer 22. 506, 507 # 22-322 OLY..... Enspira..... 508, 509 # 22-322 PRS..... Infant Car Seat. 510 Pride Trimble/Virco # 22-322 PTK.... # 832. 472 # 22-325 COB..... OnBoard..... 512 # 22-325 PAC..... # 890. 470, 471 510 507 Uptown..... 514 510 Click-n-Go...... 470, 471 # 22-380 MSA..... Vantage Highback. 515 Pride Ride..... 472 Vantage Point/Surveyor. 515 # 22077x..... Questor # 22078x..... Snug Seat # 22151. 500 # 22152x. 501 # 22159x. 501 Kantwet Car Seat. 473 Recaro # 330.00.xxx..... 478 # 22172x..... 501 # 22177x..... # 330.01.xxx..... 478 Spelcast..... # 331.00.xxx...... 474, 475, 476, 477 # 22178x..... # 331.01.xxx...... 476 # 22185x.... # 22187xxx.... Strolee # 22188x.... # 22195x..... Regal Lager (Cybex) # 22356x.... 512 # 22412x..... # 0500760xx..... 330 330 508 # 22451. # 22452. Wee Care..... 519, 520, 521 Renolux (FBS) Team-Tex # 22453x..... # 22456x..... 501 GT 5000 Turn A Tot. 487, 488, 489 # 22469x..... 501

OLDER MODEL LIST

Page 31 of 31

OLDER MODEL LIST

April 5, 2021

OLDER MODEL LIST

OLDER MODEL LIST

OLDER MODEL LIST

OLDER MODEL LIST

OLDER MODEL LIST